





Item	Qty.	Description
1	1	40"h RSG540 Oval Vertical Extrusion w/ Door Hinge
2	1	40"h RSG540 Oval Vertical Extrusion w/ Door Stop
3	1	40"h RSG540 Oval Vertical Extrusion
4	1	40"h RSG540 Oval Vertical Extrusion
5	1	8"w Z46 Horizontal Extrusion w/ lip
5A	1	8"w Z45 Horizontal Extrusion
6	1	8"w Z46 Horizontal Extrusion w/ lip
6A	1	8"w Z45 Horizontal Extrusion
7/7A	1/1	22"w Z45 Curved Horizontal Extrusion
8/8A	1/1	16.138"w Z45 Curved Horizontal Extrusion

Steps:

- 1) Connect horizontals [5] between verticals [1] & [4];
Place Infill; secure with horizontal [5A].
- 2) Connect horizontal [6] between verticals [2] & [3];
Place Infill; secure with horizontal [6A].
- 3) Attach curved horizontal [7] between verticals [3] & [4];
Place Infill; secure with horizontal [7A].
- 4) Connect curved horizontal [8] between verticals [1] & [2].
- 5) Place Shelf/Bottom to rest on lips of horizontals [5] & [6].
- 6) Connect curved horizontal [8A] between verticals [1] & [2].
- 7) Place Counter on top of assembled pedestal body.
- 8) Hang assembled door on the hinges attached to vertical [1].
See **Door Attachment** detail.

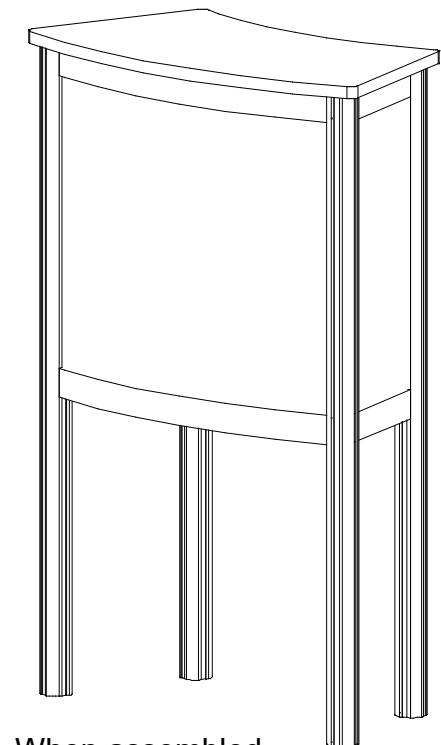


When assembled

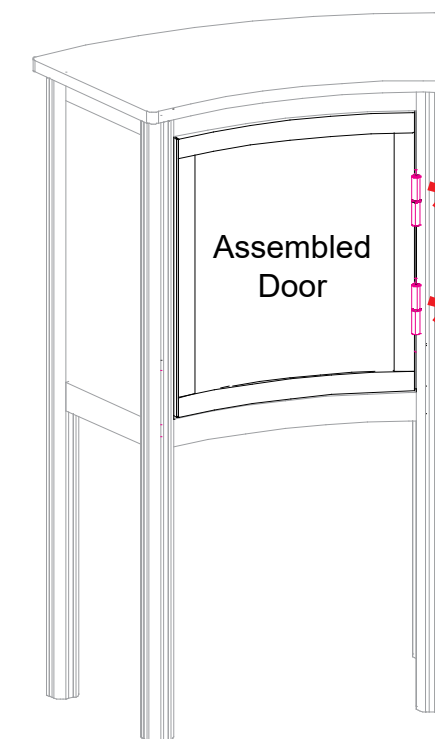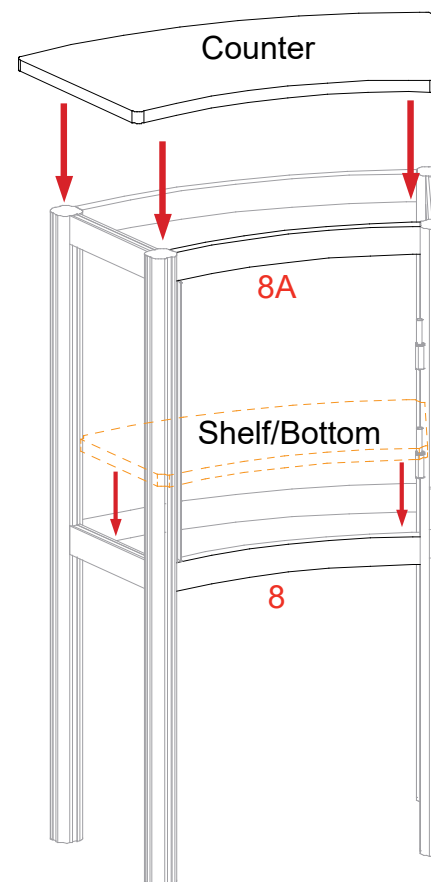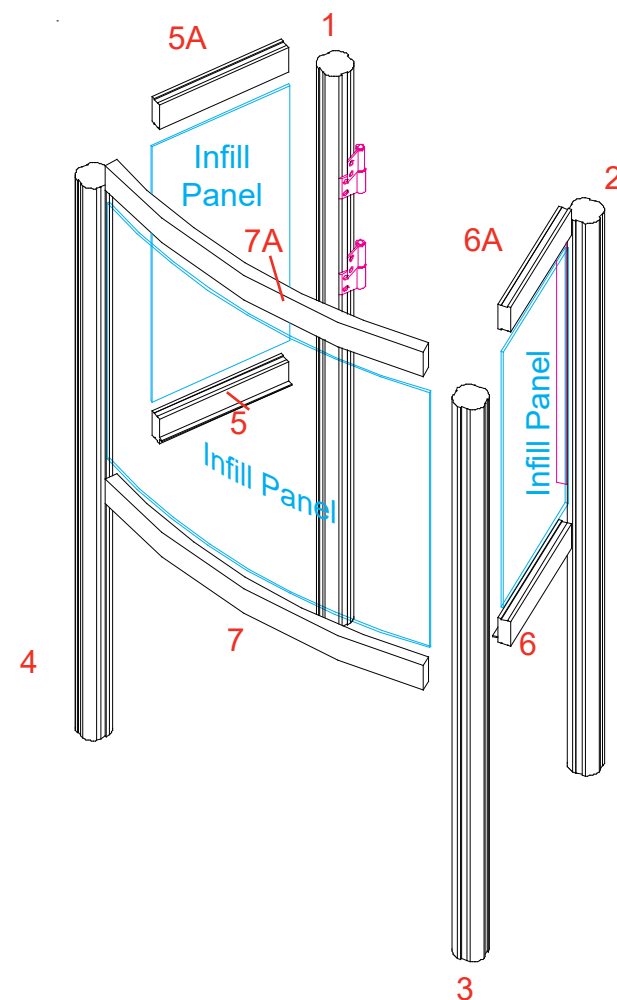

* Door Attachment

Slide pin into hinge attached to vertical.
Slide door hinge over pin.

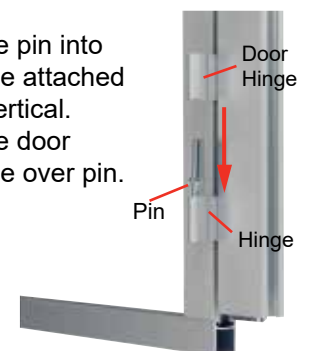

SETUP INSTRUCTIONS

General Setup Instructions


- Read entire setup instruction manual prior to unpacking parts and pieces.
- The setup instructions are created specifically for this configuration.
- Setup instructions are laid out sequentially in steps, including exploded views with detailed explanation for assembly.

Cleaning & Packing


- For Cleaning Metal, Plex, & Laminate Parts: Use a **MILD NON-ABRASIVE** cleanser and soft cloth/paper towel to clean all surfaces.
- Keep exhibit components away from heat and prolonged sun exposure.
Heat and UV exposure will warp and fade components.
- Retain all provided Packing Materials. All provided packing materials are for ease of repacking & component protection.

Disassembly


- For loss prevention, tighten all set screws and locks during disassembly.

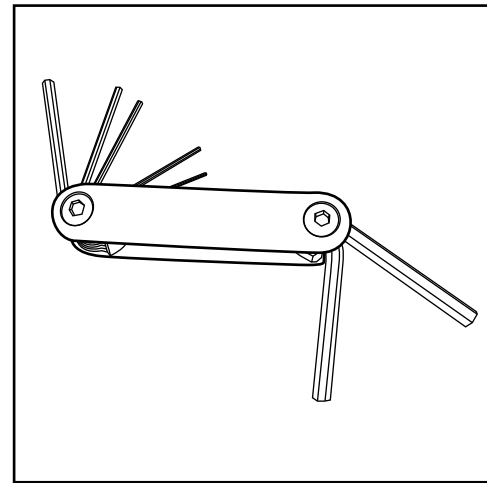


Hex Tool - Essential for Assembly

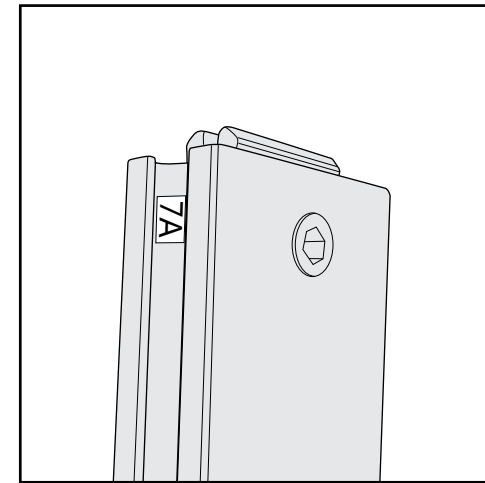


Part Identification - Numbering

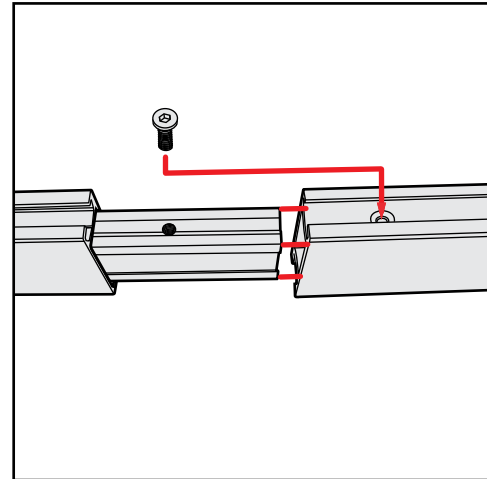


Spline Connection

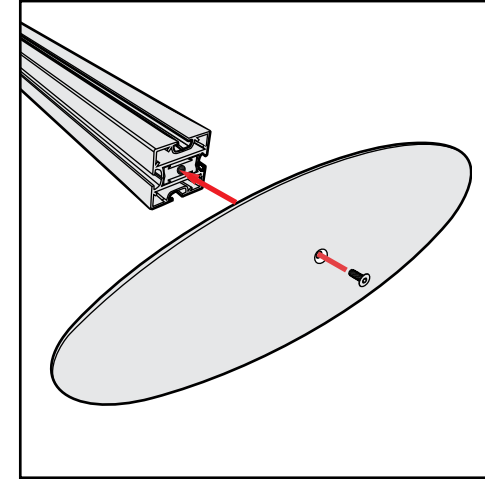

Base Plate & Extrusion Connection

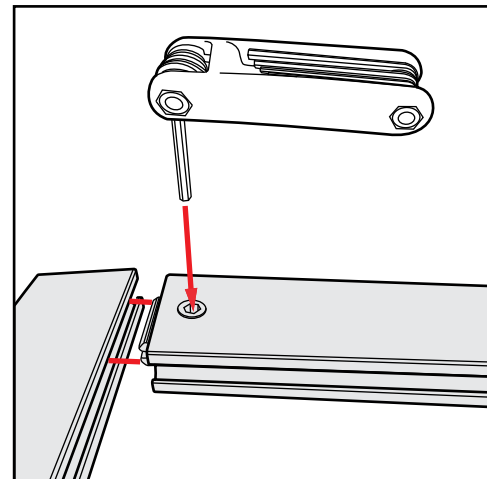

Extrusion & Lock Connection

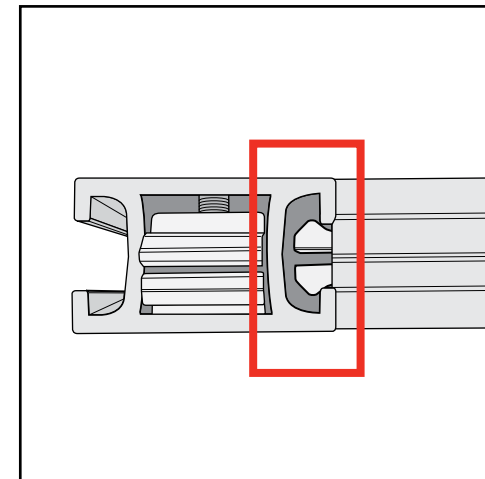


Engaged Lock



WARNING



DO NOT USE POWER TOOLS

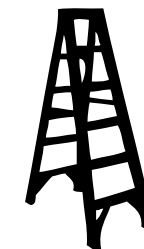

LADDERS OR LIFTS
MAY BE REQUIRED



ALL CONNECTIONS MUST
BE TIGHTLY SECURED

Top View of Each Level

